

CABIN AIR FILTER

IDENTIFICATION / INSTALLATION

IMPORTS

PA4096

BMW 318, 325i, 325iC, 325iS, 325iX, 328 Series, 525i, 525iT, M3




OE: 64111393489, 64119069895


Fits: 1994-99 BMW 318
1990-95 BMW 325i, 325iS
1990-92 BMW 325iC
1990-91 BMW 325iX
1996-99 BMW 328 Series, M3
1991-95 BMW 525i
1993-95 BMW 525iT

Size: 11 5/8 x 6 1/2 x 31/32
(295.3 x 165.1 x 24.6)


A. Gskt.: [1] Attached

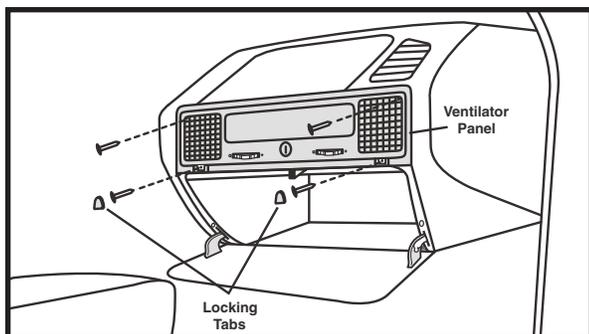


1. Open passenger side door.
2. Close vents.
3. Remove screws in vents above glove compartment.
4. Open glove compartment.
5. Remove locking tabs and screws under vents.

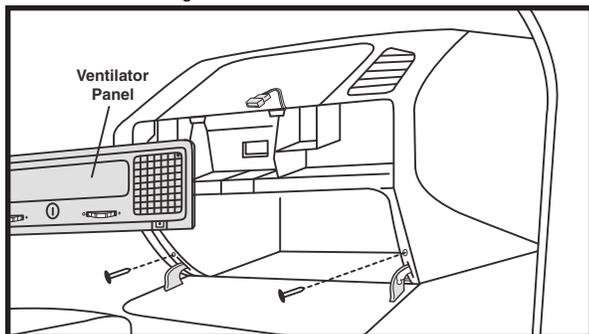


6. Remove ventilator panel.
7. Unhook hinges on glove compartment door and remove door.
8. Remove screws above door hinges.

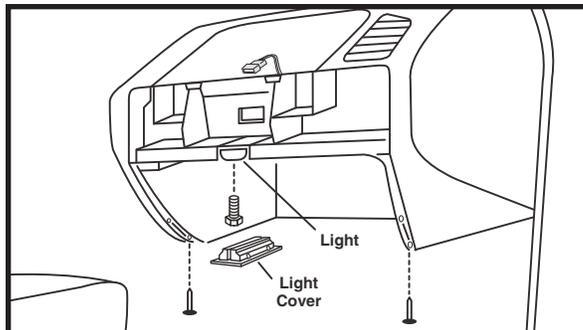

9. Remove screws on either side of glove compartment opening.
10. Remove light cover to access hex bolt and remove hex bolt.
11. Unplug and remove light.
12. Remove glove compartment.

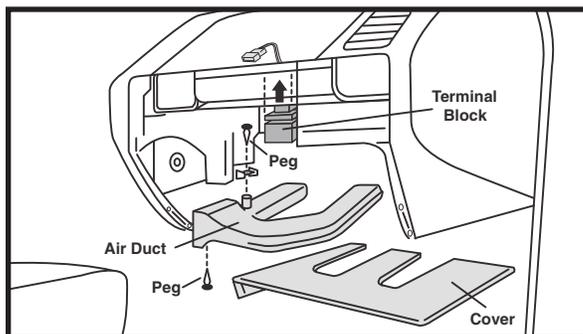

13. Remove cover.
14. Remove plastic pegs from air duct.
15. Remove air duct.
16. Move any cable assembly to side and push terminal block upwards, out of holder.

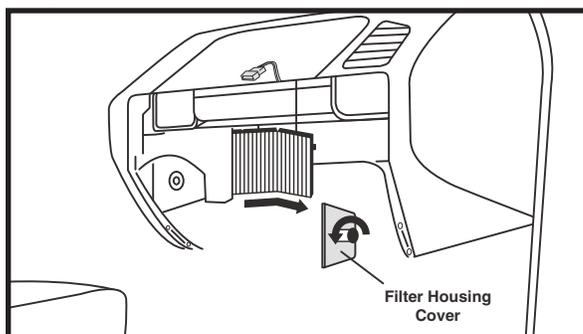

17. Turn wheel on filter housing cover 90° counter clockwise.
18. Remove filter housing cover.
19. Bend filter at folding points and remove.
20. Replace filter (bend new filter at folding points, with tab facing out) and reassemble.

Notice: The information provided is based on the latest authoritative information available at press time. However, due to manufacturers' changes, and year and model variations, Baldwin Filters cannot be responsible for misapplications and instruction errors.

BALDWIN FILTERS® **BALDWIN**
a CLARCOR company

4400 East Highway 30 ■ P.O. Box 6010
Kearney, Nebraska 68848-6010
Phone: (308) 234-1951 ■ Toll Free: (800) 822-5394
Fax: (800) 828-4453 ■ Int'l Fax: (308) 237-9769
Internet: www.baldwinfilter.com